


# Veeco Dektak 6M Surface Profiler

POC: Stephan Koev

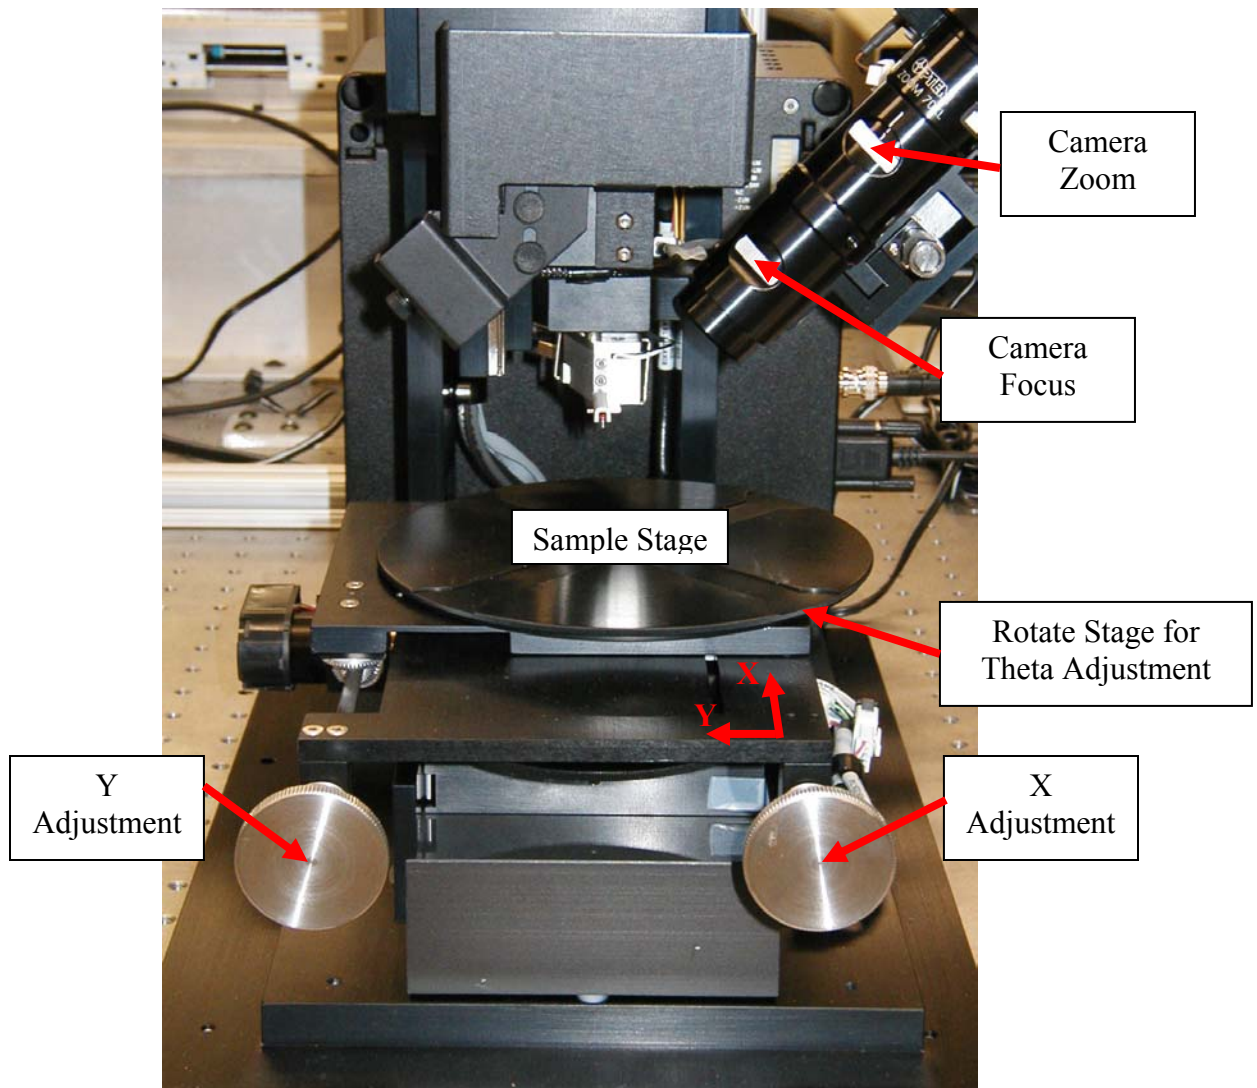


## SYSTEM CHECK AND START UP



- 1) Turn on the monitor and start the *Dektak32* application on the Desktop.
- 2) The system will initialize itself and will let you know when it is ready in the bottom left corner of the screen.


 
## LOADING/UNLOADING A SAMPLE

- 1) Load your sample on the positioning stage.

 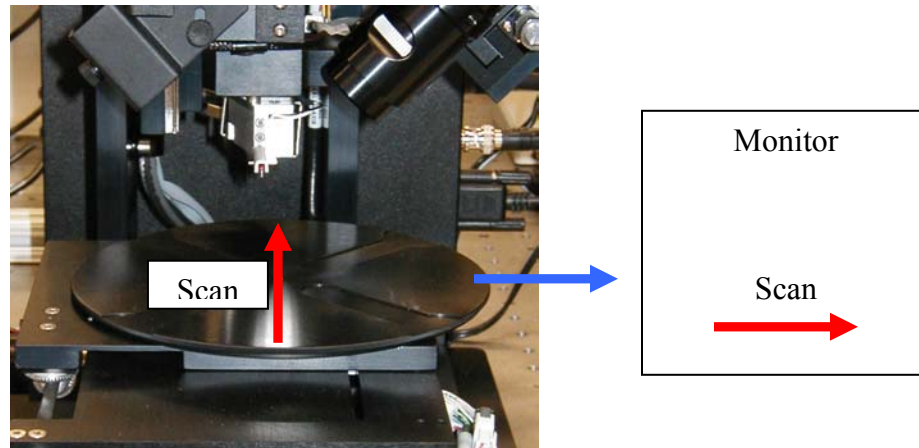
**NOTE:** The profiler is set up such that the scan is performed from front to back on the stage (left to right on the monitor); therefore it is necessary to place your sample on the stage at a rotated angle of 90 degrees so that the bottom of your sample is facing the monitor.




- 2) Press the *Sample Positioning Window Icon*, , at the top.
- 3) Once your sample is positioned click on the *Tower Down Icon*, , located at the top of the screen. The tower and stylus assembly will move down to your sample, touch the surface, and then the needle will rise up.
- 4) A video image of the sample will appear on the screen as the tower moves down.
- 5) Adjust the zoom and focus knobs on the sample viewing microscope for best results.

- 6) Adjust the sample illumination intensity by pressing the **Light Bulb Icon**, , in the upper left corner and moving the slider that appears, or by using the **Up and Down Arrows**
- 7) To unload press the **Tower Up Icon**, , and wait for the tower to completely rise. Your sample can then be removed from the stage.
- 8) Return the profiler to its standby mode by closing the **Dektak32** program and turning off the monitor.

## MAKING MEASUREMENTS

- 1) Position the cross hairs where you would like to start measuring.
  - In the **Sample Positioning Window**, navigate by turning the manual **X-Y Dials** and rotating the stage to the structure you would like to measure.
  - Use the zoom feature on the camera if needed by turning the manual **Zoom Dial**.
  - To change the intensity of the video image use the **Up and Down Arrows** to achieve the desired image.
- 2) Click on the **Scan Routines Icon**, , located at the top of the screen.
- 3) Under scan parameters click on one of the options to bring up the scan parameters dialog box.

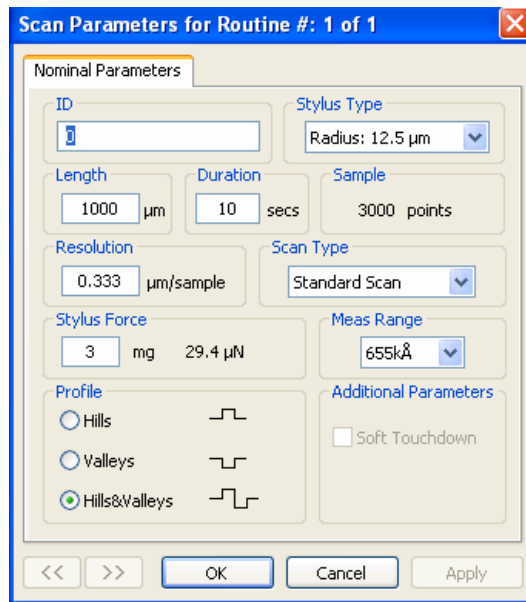

The image shows a software dialog box titled "Scan Parameters for Routine #: 1 of 1". It contains various input fields and dropdown menus for configuring a scan. The fields are organized into sections: "Nominal Parameters" (ID, Length, Duration, Resolution, Stylus Force, Profile), "Stylus Type" (Radius), "Sample" (points), "Scan Type" (Standard Scan), "Meas Range" (655kÅ), and "Additional Parameters" (Soft Touchdown). The "Profile" section has three radio buttons: "Hills", "Valleys", and "Hills&Valleys". The "Hills&Valleys" option is selected. The "OK", "Cancel", and "Apply" buttons are at the bottom.

Parameter	Value
ID	1
Length	1000 $\mu\text{m}$
Duration	10 secs
Resolution	0.333 $\mu\text{m}/\text{sample}$
Stylus Force	3 mg 29.4 $\mu\text{N}$
Stylus Type	Radius: 12.5 $\mu\text{m}$
Sample	3000 points
Scan Type	Standard Scan
Meas Range	655kÅ
Profile	Hills&Valleys
Additional Parameters	Soft Touchdown

➤ **Input the variables based on your sample and preferences:**

**Stylus type:** Leave at 12.5um unless installing a new tip!

**Length:** scan length desired.

**Duration:** Enter the duration of the scan depending on the accuracy you need.

The number of sampling points based on this time will be shown in the next box.


 

**Resolution:** resolution desired.

**Scan types:** Leave on standard scan.


**Stylus force:** Set between 1-15 mg. If measuring *resist* it should be between 1-3 mg.

**Measurement range:** Can be set from between 6.5um and 1mm.

**Profile:** select hills, valleys, or hills and valleys.


- 4) Once all variables are set select “**OK**” and then click on the *Sample Positioning Icon*, , on the top of the screen.
- 5) Adjust the measurement location if necessary and then hit the *Run Current Scan Routine Icon*, .
- 6) If there is a problem during the scan you can either hit “**Escape**” or press the  icon at the top of the screen.

## TRACE ANALYSIS

- 1) Trace Leveling
  - After the measurement is complete the program will bring you to the *Dataplot Screen*.
  - The cursors are labeled as “**R**” and “**M**” corresponding to Reference and Measurement respectively.
  - Place the cursors in the positions you would like the plot to be leveled by dragging them with the mouse.
  - If you would like the leveling to be done over a range of data points near each cursor then click on the bottom of the cursor and expand the bandwidth.
  - Hit **F8** or the *Leveling Icon*, , to level the plot.
- 2) Average Step Height Measurement

- Place the **Measurement Cursor** over the section of the plot to measure and the average step height will be displayed on the bottom right of the screen under **ASH**.
- A summary of the data will also be displayed in this area including: Reference cursor position and width, Measurement cursor position and width, average step height, and the distance between the cursors.
- If you would like to store the average step height hit **F12** and it will appear on the left hand side of the screen under **Analytic Results**. The individual results can be deleted by selecting them and hitting **Delete**.

### 3) Analytical Functions

- When in the dataplot screen press the **Calculator Icon**, , or click on the analysis menu and select analytical functions.
- In the dialog box that appears it is possible to select multiple parameters to calculate including: roughness, height, waviness, and geometry.
- Hit **Compute** to finish the calculation.
- More details on this function can be found in the user's manual.

## EXPORTING DATA

- 1) In the dataplot view, click on the file menu and select **Export**.
  - Save the data as **Scan Data** unless you are creating an auto-program which can be found in the user's manual.
  - Select if it should be saved as either **Tab Delimited** or **Comma Delimited**.
  - Select if you would like to **Overwrite** the existing file or **Append** the data to an existing text file.

*Any further questions regarding the use of this tool that are not covered in this SOP or the users manual should be brought to the attention of the POC.*